PROJECT TITLE/SITE NAME: PROJECT MANAGER/AUTHOR: PROJECT MANAGER/AUTHOR: PROJECT MANAGER/AUTHOR: PROJECT DIRECTOR/TATL: JGC Chandler NATURE OF DOCUMENT: TET-94/80-07R/LM0030TSPA NATURE OF DOCUMENT: SITE ASSESSMENT TECHNICAL EDITOR: JGC Chandler WORD PROCESSOR: WORD				BLICATION TRA Be Completed By Proj		Recd	KC 17/94			
PROJECT MANAGER/AUTHOR: KINSTH TDD/PAN: TD7-94/0-078/EM0030TS/A PROJECT DIRECTOR/TATL: JGC Chandler NATURE OF DOCUMENT: SITE ASSESSMENT TECHNICAL EDITOR: JGC Chandler WORD PROCESSOR: KIACOTH KAINS PEER REVIEWER: GRAPHICS: DATE SEQUENCE GRAPHICS: DATE SEQUENCE STEP CHANGLER DATE REVIEWER BY/TYPED BY INTIALS DATE I KINSTH MILLS DATE REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY I MILLS DATE I MILL	PROJEC	CT TITLE/SITE NAME: C	ertain-Te	ed Maline Cool	/ NOB NO.:	ZT 3071				
PROJECT DIRECTOR/TATL: JGC Chandles NATURE OF DOCUMENT: STEP ASSESSMENT TECHNICAL EDITOR: JGC Chandles WORD PROCESSOR: KIACOTH / Korns PEER REVIEWER: Gary Haden GRAPHICS: JGC Chandles DUE DATE: // -30 - 94 LIST ALL REVIEWERS/WORD PROCESSORS IN PREFERRED SEQUENCE (INSTRUCTIONS on back of form) SUBMITTED REQUIRED INITIALS DATE 1 Minorth // -/5 - 94 2 Fam Kerns Mail // -/5 - 94 3						T07-9410-078/EM003075DA				
TECHNICAL EDITOR: JEC Chander WORD PROCESSOR: KIACOTH KAME PEER REVIEWER: GRAPHICS: LIST ALL REVIEWERS/WORD PROCESSORS IN PREFERRED SEQUENCE (Instructions on back of form) STEP LIST ALL REVIEWERS/WORD PROCESSORS IN PREFERRED SEQUENCE (Instructions on back of form) JATE REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY INITIALS DATE INITIALS DATE INITIALS DATE INITIALS AND II-15-94 A Jac Chander PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL sign-off (and gives to support steff to make copies) SPECIAL INSTRUCTIONS: ACC description attached? TATL/ATATI, initials (draft ACC): Yes Spall check? Data(si)? II-15-94 Support and Support and Support and Support steff to make copies) Support and Individual (Lacult) Support and Individual (Lacult) Support made? How many? Other instructions: Support and Support and				١.		cia A	L I			
PEER REVIEWER: GRAPHICS: LIST ALL REVIEWERS/WORD PROCESSORS IN PREFERRED SEQUENCE (IINSTRUCTIONS: LIST ALL REVIEWERS/WORD PROCESSORS IN PREFERRED SEQUENCE (IINSTRUCTIONS: LIST ALL REVIEWERS/WORD PROCESSORS IN PREFERRED DATE DATE OATE REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY INTIALS DATE INTIALS REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY INTIALS DATE INTIALS REVIEWED BY/TYPED BY REVIEWED BY/TYPED BY INTIALS DATE INTIALS REVIEWED BY/TYPED BY INTIALS DATE INTIALS REVIEWED BY/TYPED BY INTIALS DATE INTIALS INTIALS REVIEWED BY/TYPED BY INTIALS DATE INTIALS INTI				1.		11.00 11	1.			
UST ALL REVIEWERS/WORD PROCESSORS IN PREFERRED SCOUNCE (Instructions on back of form) 1 MINOTA II-IS-9Y MINIALS DATE 2 Fam Kerns NAPL II-IS-9Y MINIALS II-IS-9Y 3				<u> </u>		NITTOTA	1			
STEP CONTROL C	PEER RE	:VIEWER:		Carry House		<i>:</i> /	- 94			
PROCESSORS IN PREFERRED SEQUENCE (Instructions on back of form) 1	GRAPHI	cs:	NA		DUE DATE:		<u> </u>			
SEQUENCE INSTRUCTIONS: SEQUENCE SUBMITTED DATE SUBMITTED REQUIRED INITIALS DATE INITIALS DATE INITIALS DATE REQUIRED INITIALS DATE INITIALS INI						DEVIEWED	DV/TVDED DV			
1 SUNOTA 11-15-94 2 Fam Kerns MATL 3	^TEB	SEQUENCE	}		1					
2 Fam Kerns MAT 3 1 EMAT 4 Joe Chander 6 6 7 8 9 10 PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on latterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached? Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? Copies made? How many? Other instructions: Dir./TATL 30290725 Dir./TATL 30290725 Supportund Dir./TATL 30290725 Dir./TATL 30290725 Supportund	SIEP	V. 11	of torm)		KEGOIKED	140	15 911			
3				11-15-77	ļ	CYUK _	11-13-17			
4 Joe Changer 5 6 7 7 8 9 10 PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? Copies made? How many? Other instructions: Other instructions: Other instructions:					ļ	107	11-18-44			
PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finelize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? Copies made? How many? Other instructions: D7R + 30290725 Supperfund			EMHALL	·	 	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	111011			
PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? Copies made? How many? Other instructions: Superfund Superfund		Joe Chandle			-	//cc	11/17/17			
PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: ADC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? II - IS 94 Copies made? How many? Other instructions: Diff 30290725 Superfund Superfund	— <u> </u>				-		+			
PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? // Is 94 Copies made? How many? Other instructions: OTH 30290725 Superfund						 	+			
PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? 11-15-94 Copies made? How many? Other instructions: DIV. F. 30290725 Superfund					1	<u> </u>	+			
PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? // 15 94 Copies made? How many? Other instructions: DTL f 30290725 D. D Superfund					 	 	+			
PREFERRED FINAL APPROVAL STEPS 11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? //- //- //- //- //- //- //- //- //- //						 	 			
11 Proj. Dir./TATL approval 12 Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? // // // // // // // // // // // // //		1	PRI	EFERRED FINAL A	PPROVAL STEPS					
Word Processor/finalize/format/put on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)?	11	Proj Dir /TATI approval		l		11/-	111794			
on letterhead 13 Proj. Dir./TATL sign-off (and gives to support staff to make copies) SPECIAL INSTRUCTIONS: AOC description attached?: Ye.S TATL/ATATL initials (draft AOC): Ye.S Spell check? Date(s)? // // // // // // // // // // // // //			rmat/nut			7.	11/1//			
SPECIAL INSTRUCTIONS: AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? //- 15 94 Copies made? How many? Other instructions: D7LF 30290725 D.D Oliver 1730994	· -		Tillat/put							
AOC description attached?: Yes TATL/ATATL initials (draft AOC): Yes Spell check? Date(s)? //- 15-94 Copies made? How many? Other instructions: OTHER 30290725 Superfund	13	<u> </u>	_							
Spell check? Date(s)? Copies made? How many? Other instructions: OTHER 30290725 Superfund Superfund	SPECIAI	L INSTRUCTIONS:								
Spell check? Date(s)? Copies made? How many? Other instructions: DILF 30290725 Superfund Superfund	AOC de	scription attached?:	7e.s							
Copies made? How many? Other instructions: OTHER 30290725 Superfund	TATL/A	TATL initials (draft AOC):	yer							
Other instructions: $ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	Spell ch	eck? Date(s)?	1-15-9	4	17770	1111	eek]			
Other instructions: Superfund Superfund	Copies r	nade? How many?	- 107V	<u></u>	- IRm		160			
	Other in	structions:	- UK	30290725	10.0 LOG	ber TAT				
				Superfund		4,30	14)			
0UDD ES			OUO1		ES					

The following are instructions for use of the new Publication Tracking Form.

Prior to preparing a publication, it is the responsibility of the project manager to:

- Conduct a pre-publication integrated planning meeting to define roles and responsibilities of each person involved with the publication process. All information pertaining to the publication and manner of key members should be filled-in on the top part of the form that attached example).
- Define the routing of the publication and interim required dates to the
 best of the project manager's and key member's availability. This
 information should be filled-in on the middle part of the form BEFORE this form/report leaves the author's hand.

IF STEPS CANNOT BE FOLLOWED IN SEQUENCE -- GO TO NEXT STEP. IF AUTHOR CANNOT SIGN-OFF -- GIVE TO HIEU VU OR JOE CHANDLER (for TAT reports); TO JOHN CAOILE OR JIM JACKSON (for commercial reports).

 Include any special instructions concerning formats and production of the publication (i.e. how many copies, table format, large-size maps, attachments, materials needed for binding/presentation purposes, etc.), or any other comments on the bottom section of the form.



ecology and environment, inc.

CLOVERLEAF BUILDING 3, 6405 METCALF, OVERLAND PARK, KANSAS 66202, TEL. 913/432-9961

International Specialists in the Environment

MEMORANDUM

TO:

Roy Crossland, EPA/DPO

FROM:

Dave Kinroth, E & E/TAT

THRU:

Joe Chandler, E & E/TATL

DATE:

November 18, 1994

SUBJECT:

Site Assessment: CertainTeed-Maline Creek,

Bellefontaine Neighbors, Missouri

TDD: T07-9410-078
PAN: EM00307SDA
OSC: Don Hamera

The Ecology & Environment, Inc. (E & E), Technical Assistance Team (TAT) was tasked by the U.S. Environmental Protection Agency (EPA), Region VII Emergency Planning and Response (EP&R) Branch to develop a Quality Assurance Sampling Plan (QASP) for the collection of air and soil samples for asbestos analysis from the residential area in Bellefontaine Neighbors, Missouri, adjacent to the former CertainTeed/GAF manufacturing sites and Maline Creek. This area was affected by flooding in 1993 and it was believed that asbestos contamination may have been spread by the flood water from the CertainTeed/GAF site. Upon EPA approval of the QASP, TAT was requested to implement the field activity as proposed. TAT drafted the QASP as specified and submitted the draft to EPA/EP&R for However prior to approval of the QASP the EPA/EP&R role with this site diminished due to involvement by several other agencies including the Federal Emergency Management Agency (FEMA), the Missouri Department of Natural Resources (MDNR), the local governments, the potentially responsible parties (PRPs). and Following submission of the attached draft QASP, no further activity has been requested from the TAT.

ATTACHMENTS

Draft Quality Assurance Sampling Plan

94100078\EM00307SDA

DK/BJ

QUALITY ASSURANCE SAMPLING PLAN FOR THE COLLECTION OF AIR AND SOIL SAMPLES FROM RESIDENTIAL AREAS NEAR THE CERTAIN-TEED/MALINE CREEK SITE FOR ASBESTOS ANALYSIS

(BELLEFONTAINE NEIGHBORS, ST. LOUIS COUNTY, MISSOURI)

U.S. EPA REGION VII EMERGENCY PLANNING AND RESPONSE BRANCH

and

ECOLOGY AND ENVIRONMENT, INC. TECHNICAL ASSISTANCE TEAM

October, 1994

APPROVED:	
•	
On-Scene Coordinator	Date
Peer Reviewer	Date
Chief, Emergency Planning & Response Branch	Date
	·
Regional Quality Assurance Officer	Date

QUALITY ASSURANCE SAMPLING PLAN FOR THE COLLECTION OF AIR AND SOIL SAMPLES FROM RESIDENTIAL AREAS NEAR THE CERTAIN-TEED/MALINE CREEK SITE FOR ASBESTOS ANALYSIS

I. INTRODUCTION

A. Site Location

The Certain-Teed/Maline Creek site is located at 600 St. Cyr Road in Bellefontaine Neighbors, Missouri. Bellefontaine Neighbors is a suburban city in north St. Louis County. The geographic coordinates of the site are 38044'03" N latitude and 90013'12" W longitude. A site location map is included as attachment A to this plan.

B. Site Description

The site consists of the former Certain-Teed Transite Pipe Plant property at 600 St. Cyr Road and the former GAF Transite Plant property at 9215 Riverview Boulevard, adjacent to the former Certain-Teed property to the south-southeast. Both Certain-Teed and GAF manufactured asbestos containing transite pipe and sheeting and used the field between the two facilities as an open dump for scrap materials (Attachment B). The area around the properties is industrial/residential and is in the city limits of Bellefontaine Neighbors and Riverview, Missouri. Maline Creek flows south-southeast along the southern boundary and eventually empties into the Mississippi River approximately three-fourths of a mile from site. The area directly south-southeast of Maline Creek along the site is a residential subdivision and there is a nursing home 350 feet northwest of the site.

C. Site History

Certain-Teed Corporation manufactured asbestos-cement pipe at this site from the mid 1920s until May 11, 1979, when manufacturing operations ceased. The neighboring GAF Transite Plant also ceased operation sometime in 1979. Up until that time, both facilities reportedly used the land between their plants as an open dump for scrap asbestos and settled solids from process wastewater. In February 1979, both companies hired the same consulting engineering firm, Reitz & Jens, to begin preparing closure plans for Certain-Teed and GAF to minimize the potential for adverse environmental impact and to comply with Missouri Solid Waste Management Law. Subsequent plans approved by the Missouri Department of Natural Resources (MDNR) included reworking the material to an acceptable slope, applying an earthen cover of at least 12 inches, seeding the site to establish vegetative growth, and constructing a rock

covering on the creek slope to prevent erosion.

A site inspection conducted by MDNR on May 13, 1980, confirmed that the site was in basic conformance with the approved closure plans, however it was noted that broken pieces of asbestoscontaining pipe were scattered along the undisturbed creek bank upstream of the rip-rap work area and south of the former Certain-This condition was not determined to pose a Teed facility. significant threat due to the wooded nature of the creek bank at The Certain-Teed Corporation sold the property to the Investments, in September owner, P.G. 1981. Investments, owned and operated by Phillip and Gerald Kootman, subsequently opened Branch Metal Processing Company at the site. In January 1982, pipe material became visible along the creek bank after the Metropolitan St. Louis Sewer District (MSD) conducted tree and brush removal along the creek to facilitate future creek channelization efforts. This left the material sloughing and weathering with stream flow fluctuations. recommended at that time that any removal and stabilization efforts be coordinated with MSD.

In May 1982, MSD proposed a cleanup of the creek bank. MDNR approved the plan with the condition that the waste be disposed at an approved sanitary landfill. The cleanup began in August 1982, with several loads of scrap asbestos containing material hauled to West Lake Sanitary Landfill in Bridgeton, Missouri. According to MDNR reports, when these efforts ceased there was still approximately 1000 square feet of scrap asbestos pipe visible along the upper portion of the creek bank.

The EPA Environmental Monitoring and Compliance Branch (EMCM) conducted inspections of the former Certain-Teed and GAF facilities in May and June of 1988 respectively. Exposed transite pipe and board was observed along the creek bank and on the surface near the covered waste piles at both facilities and transite pipe was observed in the creek bed along the Certain-Teed property. Samples exposed materials collected during these inspections indicated the materials contained up to 25% chrysotile and 15% Followup site assessment activity was crocidolite asbestos. conducted at the site in March and September 1992, by the Ecology & Environment, (E & E) Inc., Technical Assistance Team (TAT) following a congressional inquiry to EPA initiated by a citizen Further sampling was conducted and photographic and video documentation of the site was produced. Sample results from this effort indicated exposed insulation, transite pipe, sheeting materials containing up to 85% chrysotile and 15 % The exposed materials appeared to be crocidolite asbestos. weathering and becoming more friable and scrap materials were observed accumulating in the creek bed as the pieces were dislodged from the creek bank through erosional processes.

During the flood event in July and August of 1993, swelling of the Mississippi River caused a back up of Maline Creek to such an extent that flooding of the common area along the south bank of the creek adjacent to the subdivision south of site occurred. In addition approximately 70 homes were flooded to varying degrees during the peak crest period. The peak crest on the Mississippi River in St. Louis occurred on August 1, 1993, with a crest stage of 49.6 feet. Approximately 20 of the affected homes are scheduled for buyout by the Federal Emergency Management Agency (FEMA). More homes were eligible for buyout however the residents refused. This flood event potentially transported asbestos fibers from the site, increasing the potential for asbestos contamination in the affected areas above and beyond that which may have been present prior to the flood.

II. OBJECTIVES

A. Objectives of Sampling Effort

The primary objective of this proposed sampling effort is to provide a rapid assessment of the potential threat from exposure to asbestos fibers to residents living in the subdivision near the site. The target population in this assessment is the residences near the area affected by the flooding in 1993, however the sampling will be conducted with the assumption that contamination by asbestos fibers at these residences may have been occurring in this area due to entrainment from the site for many years prior to the flood event.

B. Scope of Work

To achieve the aforementioned objectives for this sampling effort a network of personal sampling pumps will be set up to collect air samples for asbestos analysis near the residences affected by flooding in August, 1993. Soil samples will also be collected for asbestos analysis from selected locations. In order to determine what effect the flood may have had in spreading asbestos contamination off site several remote and background sample locations will be selected away from the area affected by the flooding. The air samples will be collected with personal sampling pumps in accordance with the National Institute for Occupational Safety and Health (NIOSH) method 7402 and with the assistance of an Asbestos Hazard Emergency Response Act (AHERA) certified air monitoring technician.

C. Data Quality Objectives

The data quality objective for this sampling effort is to provide data to give a rapid assessment of the potential threat from exposure to asbestos fibers to residents living near the Certain-Teed/Maline Creek site. Definitive identification and quantitation of the asbestos fibers in all samples will meet quality assurance level two (QA2) objectives and provide a health

and safety assessment for the site.

III. PROPOSED FIELD ACTIVITIES

A. Sampling Rationale/Methods

As mentioned previously, the air samples will be collected according to NIOSH method 7402 and in accordance with 29 CFR An AHERA certified air monitoring technician will be subcontracted to assist with the air sampling network design and sample collection. The network will be set up in the flood zone and at remote and background locations upwind and away from the site. As specified in the method, personal sampling pumps will be set up to run for eight hours at a rate of two liters per minute giving an approximate total sample volume of 960 liters. Each pump will be calibrated before and after use with a representative filter cassette installed. The collection medium or filter cassette will be the prescribed 25-mm diameter cassette with an open-faced 50-mm electrically conductive extension cowl and mixed cellulose ester filter membrane. The filter cassettes will be set at one meter above the ground during sample collection. A total of 12 air samples, including two blank samples as specified in 29 CFR 1910.1001 and one collocated sample, will be submitted to the contracted laboratory for transmission electron microscopy (TEM) asbestos analysis following NIOSH method 7402.

Surface soil samples will be collected from all air sampling locations and from selected other locations in the flood zone, remote, and background locations following E & E Standard Operating Procedures (SOP) for Soil Sampling Geotech 5.17, January 1990. The soil samples collected in association with the air sample locations will be composite samples consisting of four aliquots collected approximately 10 feet north, south, east, and west of the pump location. The remaining soil samples will be grab samples collected from selected locations. The samples will be packaged in 8-ounce glass jars. A maximum of 30 soil samples will be submitted to the contracted laboratory for TEM asbestos analysis.

A field logbook will be kept documenting all activity during this sampling. Sample documentation and management in the field will be conducted according to the following standard operating procedures:

2130.2A Field Chain of Custody for Environmental Samples 2130.3A Identification, Documentation and Tracking of Samples

B. Sampling Equipment

- 10 Gilian personal sampling pumps with flexible connecting tubing
- 1 Gilibrator primary standard airflow calibrator
- 12 25-mm x 50-mm electrically conductive filter cassettes

with mixed cellulose ester filter membranes

- compass
- survey flags
- 100' and 300' tapes
- stainless steel sampling spoons
- aluminum pie pans
- powder free vinyl surgical gloves
- 8-ounce glass sample jars
- poultry bags
- 38" x 60" poly bags
- trash bags
- paper towels
- tap water
- field sheets, sample tags, custody seals, chain-of-custody forms
- duct tape, strapping tape, clear tape
- static free packing material
- cooler for sample storage and shipment
- Level C personal protective equipment (PPE)
- 35-mm camera and film
- logbook

C. Decontamination Procedures

Dry decontamination and disposal of all PPE and expendable sampling equipment is suggested. PPE will be rendered useless and bagged for disposal. Equipment and instrumentation will be wiped down with moist towelettes and wiped dry.

IV. LOGISTICS

A. Personnel Requirements/Protective Equipment

Two TAT personnel will be required to conduct the soil sampling and to assist the subcontracted AHERA certified air monitoring technician with the air sampling. The EPA On-scene Coordinator (OSC) for this project is Don Hamera. All sampling will be conducted in level C PPE with an air-purifying respirator and hooded tyvek coveralls. Latex boot covers and inner gloves will be utilized and sealed with duct tape to the tyvek coveralls. A new pair of powder free vinyl surgical gloves will be donned for each sample collected to minimize the potential for cross contamination of samples.

B. Schedule

A meeting between EPA, MDNR, and local personnel regarding the site and access has been scheduled for Thursday October 27, 1994. The sampling effort has been tentatively scheduled to follow this meeting on Tuesday November 1 and Wednesday November 2, 1994. The

sampling will be postponed if it is raining or conditions are wet.

C. Access

Permission to access the former Certain-Teed property will be obtained through EPA at the meeting on October 27, 1994. Permission to access the residences and remote locations for air and soil sampling will be acquired at this same time by the OSC.

D. Media/Public Inquiries

All inquiries concerning the site and the sampling effort will be referred to the OSC or the EPA Region VII Office of Public Affairs for response.

V. ANALYTICAL METHODS

A. Analytical Procedures

Both the air and soil samples will be analyzed by transmission electron microscopy (TEM) at a National Institute for Standards and Technology (NIST) accredited laboratory. As mentioned previously, the air samples will be collected and analyzed according to NIOSH method 7402 and in accordance with 29 CFR 1910.1001 guidelines. The data will be reported in fibers per cubic centimeter of air (f/cc). Soil samples will be analyzed by the TEM modified Chatfield method with the data reported in percentage by fiber species. Holding time on the samples is indefinite.

B. Method Detection Limits

The estimated method detection limit for TEM analysis for asbestos in air is .005 fibers per cubic centimeter. A structure must be longer than five microns and have at least a 3 to 1 length to diameter ratio to be counted as a fiber. An action level of 0.1 fiber per cubic centimeter as an 8-hour time weighted average (TWA) has been established as the concentration above which employers must initiate compliance activities. The Occupational Safety and Health Administration (OSHA) permissible exposure limit (PEL) for asbestos is an 8-hour TWA of 0.2 fiber per cubic centimeter. For bulk and soil sample asbestos analysis EPA considers any material containing greater than 1% asbestos as asbestos containing material (ACM). Any material containing less than 1% asbestos is not considered ACM.

C. Quality Control

Overall quality control for the sampling phase of this project



shall be the joint responsibility of the TAT field team leader and the OSC. The laboratory quality control shall follow the quality control procedures specified by the respective methods.

VI. REFERENCES

Ecology & Environment, Inc., Technical Assistance Team, May 8, 1992. Certain-Teed Transite Pipe Site Assessment, TDD T07-9203-012, submitted to U.S. EPA Region VII Emergency Planning and Response Branch, Kansas City, Kansas.

Ecology & Environment, Inc., Technical Assistance Team, September 21, 1992. Certain-Teed-Maline Creek Site Assessment, TDD T07-9209-003, submitted to U.S. EPA Region VII Emergency Planning and Response Branch, Kansas City, Kansas.

Ecology & Environment, Inc., Technical Assistance Team, March 14, 1994. Maline Creek Site Assessment, TDD T07-9402-015, submitted to U.S. EPA Region VII Emergency Planning and Response Branch, Kansas City, Kansas.

Missouri Department of Natural Resources, Waste Management Unit, August 28, 1984, Preliminary Assessment-Branch Metal Processing Company, 3012 Summary, Case 534.918.

U.S. Environmental Protection Agency, 1988, Environmental Monitoring and Compliance Branch, Inspection Report on the Certain-Teed Transite Pipe Plant, St. Louis, Missouri.

U.S. Environmental Protection Agency, 1988, Environmental Monitoring and Compliance Branch, Inspection Report on the GAF Transite Plant, St. Louis, Missouri.

ATTACHMENTS

Attachment A - Site Location Map

Attachment B - Site Sketch


Attachment C - Areas Affected by Flooding/Proposed Sampling Locations

Attachment D - 29 CFR 1910.1001-Appendix A; B Sampling Procedures


ATTACHMENT

Α




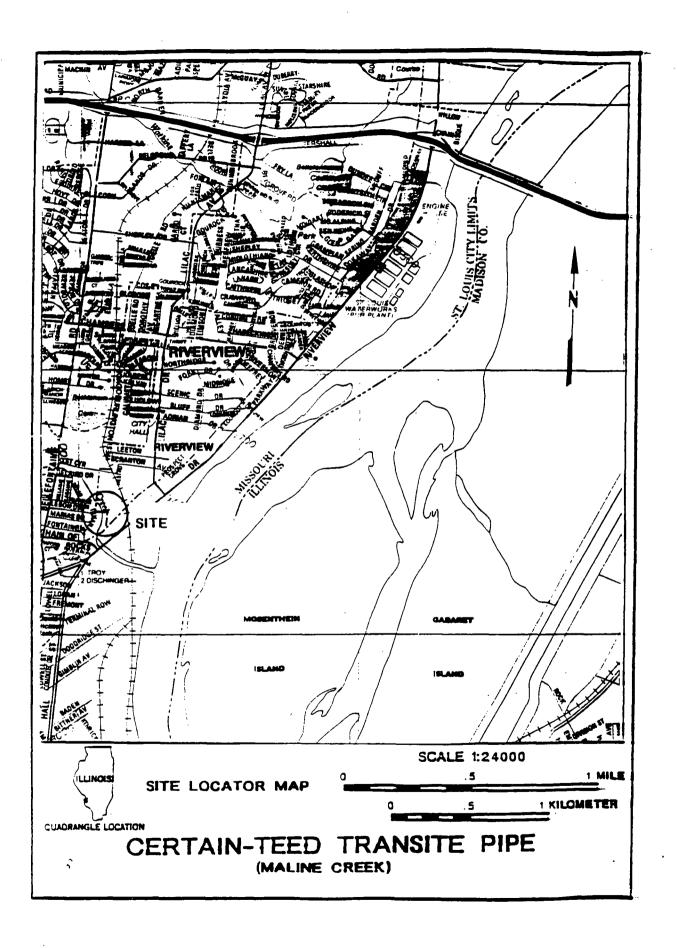

ATTACHMENT B

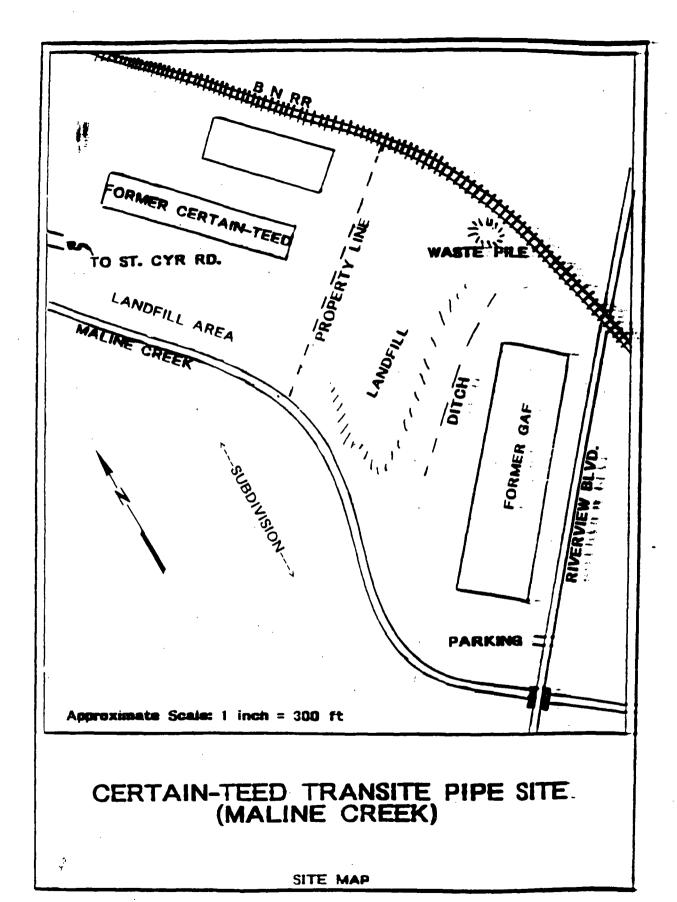

ATTACHMENT C

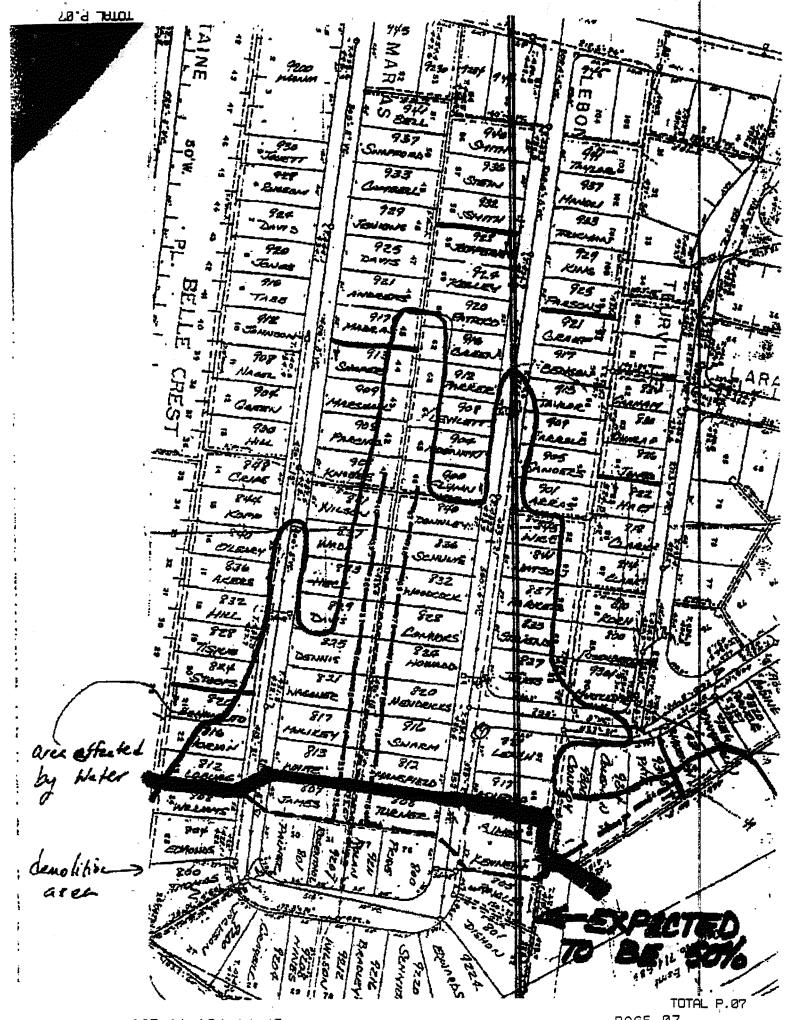



ATTACHMENT D

Admin., Labor

\$ 1910,1001

ossible

ursion ursion n shall

;), (h), hall be 1988, ection, ch 13,

(iii) Paragraph (i) of this section, shall be complied with by September 14, 1989.

(4) Compliance data. The requirements of paragraphs (iX4), (jX1Xiv), (j)(5XiiXI), (jX5XiiXX), and (lX7XiXD) shall be complied with by May 7, 1990.

(p) Appedices. (1) Appendices A. C. D. and E to this section are incorporated as part of this section and the contents of these Appendices are mandatory.

(2) Appendices B. F. G. H. and I to this section are informational and are not intended to create any additional obligation not otherwise imposed or to detract from any existing obligation.

APPENDIX A TO § 1910.1001—OSHA REFERENCE METEOD—MANDATORY

This mandatory appendix specifies the procedure for analyzing air samples for asbestos and specifies quality control procedures that must be implemented by laboratories performing the analysis. The sampling and analytical methods described below represent the elements of the availsole monitoring methods (such as the NIOSH 7400 method) which OSHA considers to be essential to achieve adequate employee exposure monitoring while allowing employers to use methods that are already established within their organizations. All employers who are required to conduct air monitoring under paragraph (d) of the standard are required to utilize analytical laboratories that use this procedure, or an equivalent method, for collecting and anslyzing samples.

Sampling and Analytical Procedure

1. The sampling medium for air samples shall be mixed cellulose error filter membranes. These shall be designated by the manufacturer as suitable for aspectos counting. See below for rejection of blanks.

 The preferred collection device shall be the 25-mm diameter camette with an openfaced 50-mm electrically conductive extension cowi. The 27-mm casette may be used if necessary but only if written justification for the need to use the 27-mm filter cassette accompanies the sample results in the employee's exposure monitoring record. >

3. An air flow rate between 0.5 liter/min and 2.5 liters/min shall be selected for the 25-mm cassette. If the 37-mm cassette is used an air flow rate between 1 liter/min and 2.5 liters/min shall be selected.

4. Where possible, a sufficient air volume for each air sample shall be collected to yield between 100 and 1.300 fibers per square millimeter on the membrane filter. If a filter darkens in appearance or if loose dust is seen on the filter, a second sample shall be started.

5. Ship the samples in a rigid container with sufficient packing material to prevent disloging the collected fibers. Packing material that has a high electrostatic charge on its surface (e.g., expanded polystyrene) cannot be used because such material can cause loss of fibers to the sides of the cassette.

 Calibrate each personal sampling pump before and after use with a representative filter cassette installed between the pump and the calibration devices.

7. Personal samples shall be taken in the "breathing sone" of the employee (i.e., attached to or near the collar or lapel near the worker's face).

6. Fiber counts shall be made by positive phase contrast using a microscope with an 8 to 10 X eyepiece and a 40 to 45 X objective for a total magnification of approximately 400 X and a numerical aperture of 0.68 to 0.75. The microscope shall also be fitted with a green or blue filter.

9. The microscope shall be fitted with a Walton-Beckett eyepiece graticule calibrated for a field diameter of 100 micrometers (+/-2 micrometers).

10. The phase-shift detection limit of the microscope shall be about 3 degrees measured using the HSE phase shift test alide as outlined below.

a Place the test slide on the microscope stage and center it under the phase objective.

b. Bring the blocks of grooved lines into focus.

Norm The slide consists of seven sets of grooved lines (cs. 20 grooves to each block) in descending order of visibility from sets 1 to 7, seven being the least visible. The requirements for asbestos counting are that the microscope optics must resolve the grooved lines in set 2 completely, although they may appear somewhat faint, and that the grooved lines in sets 8 and 7 must be invisible. Sets 4 and 5 must be at least partially visible, but may vary slightly in visibility between microscopes. A microscope that fails to meet these requirements has either

\$ 1910.1001

too low or too high a resolution to be used for asbestos counting.

c. If the image deteriorates, clean and adjust the microscope optics. If the problem persists, consult the microscope manufacturer.

11. Each set of samples taken will include 10 percent blanks or a minimum of 2 blanks. The blank results shall be averaged and subtracted from the analytical results before reporting. Any samples represented by a blank having a fiber count in excess of 7 fibers/100 fields shall be rejected.

12. The samples shall be mounted by the acetone/triscetin method or a method with an equivalent index of refraction and simi-

lar clarity.

13. Observe the following counting rules.
a. Count only fibers equal to or longer than 8 micromoters. Measure the length of curved fibers along the curve.

b. In the absence of other information, count all particles as asbesto that have a length-to-width ratio (aspect ratio) of 3:1 or

greeler.

- c. Fibers lying entirely within the boundary of the Walton-Beckett graticule field shall receive a count of 1. Fibers crossing the boundary once, having one end within the circle, shall receive the count of one half (%). Do not count any fiber that crosses the graticule boundary more than once. Reject and do not count any other fibers even though they may be visible outside the graticule area.
- d. Count bundles of fibers as one fiber unless individual fibers can be identified by observing both ends of an individual fiber.
- e. Count enough graticule fields to yield 100 fibers. Count a minimum of 20 fields: stop counting at 100 fields regardless of fiber count.
- 14. Blind recounts shall be conducted at the rate of 10 percent.

Quality Control Procedures

- 1. Intralaboratory program. Each laboratory and/or each company with more than one microscopist counting slides ahall establish a statistically designed quality assurance program involving blind recounts and comparisons between microscopists to monitor the variability of counting by each microscopist and between microscopists. In a company with more than one laboratory, the program shall include all laboratories and shall also evaluate the laboratory-to-laboratory variability.
- 2. Interlaboratory program. Each laboratory analyzing asbestos samples for compliance determination shall implement an interlaboratory quality assurance program that as a minimum includes participation of at least two other independent laboratories. Each laboratory shall participate in round robin testing at least once every 6 months with at least all the other laboratories in its

29 CFR Ch. XVII (7-1-92 Builden)

interiaboratory quality assurance group. Each laboratory shall submit slices typical of its own work load for use in this program. The round robin shall be designed and results analysed using appropriate statistical methodology.

 All individuals performing asbestos analysis must have taken the NIOSH course for sampling and evaluating airborne asbestos dust or an equalivalent course.

4. When the use of different microscopes contributes to differences between counters and laboratories, the effect of the different microscope shall be evaluated and the microscope shall be repiaced, as necessary.

5. Current results of these quality assurance programs shall be posted in each laboratory to keep the microscopists informed.

APPENDIX B TO § 1910.1001—DETAILED PROCE-DURS FOR ASSESTED SAMPLING AND ANALY-RIS—NOT-MANDATORY

This appendix contains a detailed procedure for sampling and analysis and includes those critical elements specified in Appendix A. Employers are not required to use this procedure, but they are required to use Appendix A. The purpose of Appendix B is to provide a detailed step-by-step sampling and analysis procedure that conforms to the elements specified in Appendix A. Since this procedure may also standardize the analysis and reduce variability. OSHA encourages employers to use this appendix.

Asbestos Sampling and Analysis Method

Technique: Microscopy, Phase Contrast

Analyte: Fibers (manual count)

Sample Preparation: Acetone/triacetin method

Calibration: Phase-shift detection limit about 3 degrees

Range: 100 to 1300 fibers/mm * filter

Estimated limit of detection: 7 fibers/mm ² filter area

Sampler: Filter (0.8-1.2 um mixed cellulose ester membrane, 25-mm diameter)

Flow rate: 0.5 L/min to 2.5 L/min (25-mm cassette) 1.0 L/min to 2.5 L/min (37-mm cassette)

Sample volume: Adjust to obtain 100 to 1300 fibers/mm *

Shipment: Routine

Sample stability: Indefinite

Blanks: 10% of samples (minimum 2) Standard analytical error; 0.25.

Applicability: The working range is 0.02 f/cc (1920-L air sample) to 1.25 f/cc (400-L air sample). The method gives an index of air-

Occupational Safety and Health Admin., Labor

§ 1910.1001

borne asbestos fibers but may be used for other materials such as fibrous glass by inserting suitable parameters into the counting rules. The method does not differentiate between asbestos and other fibers. Asbestos fibers less than ca. 0.26 um diameter will not be detected by this method.

Interferences: Any other airborne fiber may interfere since all particles meeting the counting criteria are counted. Chainlike particles may appear fibrous. High levels of nonfibrous dust particles may obscure fibers in the field of view and raise the detection limit.

Reagents: 1. Acctone. 2. Triscetin (glycerol triscetate), reagent grade

Special precautions: Acetone is an extremely flammable liquid and precautions must be taken not to ignite it. Heating of acetone must be done in a ventilated laboratory fume hood using a flameless, spark-free heat source.

Equipment: 1. Collection device: 25-mm cassette with 50-mm electrically conductive extension cowl with collulose ester (ilter. 0.8 to 1.2 mm pore size and backup pad.

NOTE Analyze representative filters for fiber background before use and discard the filter lot if more than 5 fibers/100 fields are found.

2. Personal sampling pump, greater than or equal to 0.5 L/min. with flexible connecting tubing.

3. Microscope, phase contrast, with green or blue filter, 6 to 10% eyepiece, and 40 to 45% phase objective (total magnification ca 400%; numerical aperture - 0.65 to 0.75.

4. Slides, glass, single-frosted, pre-cleaned. 25 x 75 mm.

5. Cover slips, 28 x 26 mm, no. 1% unless otherwise specified by microscope manufacturer.

6. Knife, No. 1 surgical steel, curved blade.

7. Tweezers.

- 8. Flask, Guth-type, insulated neck, 250 to 500 mL (with single-holed rubber stopper and elhow-jointed glass tubing, 16 to 22 cm
- 9. Hotplate, spark-free, stirring type: heating mantle; or infrared lamp and magnetic stirrer.
- 10. Syringe, hypodermic, with 22-gauge needle.
- 11. Graticule, Walton-Beckett type with 100 um diameter circular field at the specimen plane (area = 0.00785 mm *). (Type G-22).

· Nors: the graticule is custom-made for each microscope.

- 12. HRE/NPL phase contrast test slide, Mark II.
- 13. Telescope, ocular phase-ring centering.
- 14. Stage micrometer (0.01 mm divisions).

Sampling

1. Calibrate each personal sampling pump with a representative sampler in line.

2. Fasten the sampler to the worker's lapel as close as possible to the worker's mouth. Remove the top cover from the end of the cowl extension (open face) and orient face down. Wrap the joint between the extender and the monitor's body with shrink tape to prevent air leaks.

3. Submit at least two blanks (or 10% of the total samples, whichever is greater) for each set of samples. Remove the caps from the field blank cassettes and store the caps and cassettes in a clean area (bag or box) during the sampling period. Replace the caps in the cassettes when sampling is completed.

4. Sample at 0.5 L/min or greater. Do not exceed 1 mg total dust loading on the filter. Adjust sampling flow rate, Q (L/min), and time to produce a fiber density, E (fibers/mm²), of 100 to 1300 fibers/m² [3.85×10° to 5×10° fibers per 28-mm filter with effective collection area (A,=385 mm²)] for optimum counting precision (see step 21 below). Calculate the minimum sampling time, t_min) at the action level (one-half of the current standard). L (f/cc) of the fibrous aerosol being sampled:

 $t_{\text{QXL}} = \frac{(\text{Ac}(\text{E}))}{(\text{QXL})10^2}$

Remove the field monitor at the end of sampling, replace the plastic top cover and small end caps, and store the monitor.

 Ship the samples in a rigid container with sufficient packing material to prevent jostling or damage.

Note: Do not use polystyrens foam in the shipping container because of electrostatic forces which may cause fiber loss from the sample filter.

Sample Preparation

Note: The object is to produce samples with a smooth (non-grainy) background in a medium with a refractive index equal to or less than 1.46. The method below collapses the filter for easier focusing and produces permanent mounts which are useful for quality control and interlaboratory comparison. Other mounting techniques meeting the above criteria may also be used, e.g., the nonpermanent field mounting technique used in P & CAM 239.

7. Ensure that the glass slides and cover slips are free of dust and fibers.

8. Place 40 to 60 ml of acetone into a Guth-type flask. Stopper the flask with a single-hole rubber stopper through which a glass tube extends 5 to 8 cm into the flask.

§ 1910.1001

The portion of the glass tube that exits the top of the stopper (8 to 10 cm) is bent downward in an elbow that makes an angle of 20 to 30 degrees with the horizontal.

 Pisce the flask in a stirring hotplate or wrap in a heating mantle. Heat the scetone gradually to its boiling temperature (ca. 58

CAUTION.—The acetone vapor must be generated in a ventilated fume hood away from all open flames and spark sources, Alternate heating methods can be used, providing no open flame or sparies are present.

10. Mount either the whole sample filter or a wedge out from the sample filter on a clean glass slide.

a. Cut wedges of ca. 25 percent of the filter area with a curved-blade steel surgical knife using a rocking motion to prevent tearing.

b. Piace the filter or wedge, dust side up, on the slide. Static electricity will usually keep the filter on the slide until it is cleared.

c. Hold the glass slide supporting the filter approximately 1 to 2 cm from the glass tube port where the acetone vapor is examping from the heated flask. The acetone vapor stream should cause a condensation spot on the glass slide ca. 2 to 3 cm in diameter. Move the glass slide gently in the vapor stream. The filter should clear in 2 to 5 sec. If the filter curis, distorts, or is otherwise rendered unusable, the vapor stream is probably not strong enough. Periodically wipe the outlet port with tissue to prevent liquid acetone dripping onto the filter.

d. Using the hypodermic syringe with a 22-cause needle, place 1 to 2 drops of triace-tin on the filter. Gently lower a clean 25-mm square cover alip down onto the filter at a slight angle to reduce the possibility of forming bubbles. If too many bubbles form or the amount of triacetin is insufficient, the cover slip may become detached within a few hours.

c. Glue the edges of the cover slip to the glass slide using a inequar or nail polish.

NOTE If clearing is slow, the slide preparation may be heated on a hotplate (surface temperature 50 °C) for 18 min to hasten clearing. Counting may proceed immediately after clearing and mounting are complet-

Calibration and Quality Control

11. Calibration of the Walton-Beckett graticule. The diameter, d.(mm), of the circular counting area and the disc diameter must be specified when ordering the graticule.

 Insert any available graticule into the eyepiece and focus so that the graticule lines are sharp and clear.

b. Set the appropriate interpupillary distance and, if applicable, reset the binocular

29 CFR Ch. XVII (7-1-92 Edition)

head adjustment so that the magnification remains constant.

c. Install the 40 to 45% phase objective.

d. Place a stage micrometer on the microscope object stage and focus the microscope on the graduated lines.

c. Measure the magnified grid length, L.(mm), using the stage micrometer.

f. Remove the graticule from the microscope and measure its actual grid length. L.(mm). This can best be accomplished by using a stage fitted with verniers.

g. Calculate the circle diameter, d.(mm), for the Walton-Beckett graticule:

$$d_{t} = \frac{L_{t} \times D}{L_{t}}$$

EXAMPLE—If $L_s = 108$ um, $L_s = 2.93$ mm and D = 100 um, then $d_s = 2.71$ mm.

h. Check the field diameter, Discorptable range 100 mm = 2 mm; with a stage micrometer upon receipt of the graticule from the manufacturer. Determine field area (mm*).

12. Microscope adjustments. Follow the manufacturer's instructions and also the following:

a. Adjust the light source for even illumination across the field of view at the condenser iris.

NOTE: Kohler illumination is preferred, where available.

 Poeus on the particulate material to be examined.

c. Make sure that the field iris is in focus, centered on the sample, and open only enough to fully illuminate the field of view.

d. Use the telescope ocular supplied by the manufacturer to ensure that the phase rings (annular disphragm and phase-shifting elements) are concentric.

13. Check the phase-shift detection limit of the microscope periodically.

a. Remove the HSE/NPL phase-contrast test alide from its shipping container and center it under the phase objective.

b. Bring the blocks of grooved lines into focus.

Note: The alide consists of seven sets of grooves (ca. 20 grooves to each block) in descending order of visibility from sets 1 to 7. The requirements for counting are that the microscope optics must resolve the grooved lines in set 3 completely, although they may appear somewhat faint, and that the grooved lines in set 6 to 7 must be invisible. Sets 4 and 5 must be at least partially visible but may vary slightly in visibility between microscopes. A microscope which fails to meet these requirements has either too low

Occupational Safety and Health Admin., Labor

\$ 1910.1001

or too high a resolution to be used for asbestos counting.

c. If the image quality deteriorates, clean the microscope optics and, if the problem persists, consult the microscope manufacturer.

14. Quality control of fiber counts.

a. Prepare and count field blanks along with the field samples. Report the counts on each blank. Calculate the mean of the field blank counts and subtract this value from each sample count before reporting the results.

Note i: The identity of the blank filters should be unknown to the counter until all

counts have been completed.

NOTE 2: If a field blank yields fiber counts greater than 7 fibers/100 fields, report possible contamination of the samples.

b. Perform blind recounts by the same counter on 10 percent of filters counted (slides relabeled by a person other than the

counter).

13. Use the following test to determine whether a pair of counts on the same filter should be rejected because of possible bias. This statistic estimates the counting repeatability at the 95% confidence level. Discard the sample if the difference between the two counts exceeds 2.77(F)s., where F-average of the two fiber counts and s.-relative standard deviation, which should be derived by each laboratory based on historical in-house data.

Note: If a pair of counts is rejected as a result of this test, recount the remaining samples in the set and test the new counts against the first counts. Discard all rejected

paired counts.

16. Enroll each new counter in a training course that compares performance of counters on a variety of samples using this procedure.

Nove To ensure good reproducibility, all inhoratories engaged in ashestos counting are required to participate in the Proficiency Analytical Testing (PAT) Program and should routinely participate with other ashestos fiber counting laboratories in the exchange of field samples to compare performance of counters.

Measurement

17. Place the slide on the mechanical stage of the calibrated microscope with the

center of the filter under the objective lens. Focus the microscope on the place of the filter.

18. Regularly check phase-ring alignment and Kohler illumination.

19. The following are the counting rules:

- a. Count only fibers longer than 5 um. Measure the length of curved fibers along the curve.
- b. Count only fibers with a length-towidth ratio equal to or greater than \$:1.
- c. For fibers that cross the boundary of the graticule field, do the following:
- 1. Count any fiber longer tha 5 um that lies entirely within the graticule area.
- 2. Count as % fiber any fiber with only one end lying within the graticule area.
- 3. Do not count any fiber that crosses the grationic boundary more than once.
- 4. Reject and do not count all other fibers.
- d. Count bundles of fibers as one fiber unless individual fibers can be identified by observing both ends of a fiber.
- e. Count enough graticule fields to yield 100 fibers. Count a minimum of 20 fields. Stop at 100 fields regardless of fiber count.
- 20. Start counting from one end of the filter and progress along a radial line to the other end, shift either up or down on the filter, and continue in the reverse direction. Select fields randomly by looking away from the eyepiecs briefly while advancing the mechanical stage. When an agglomerate covers ca. % or more of the field of view, reject the field and select another. Do not report rejected fields in the number of total fields counted.

Note: When counting a field, continuously scan a range of focal planes by moving the fine focus knob to detect very fine fibers which have become embedded in the filter. The small-diameter fibers will be very faint but are an important contribution to the total count.

Calculations

21. Calculate and report fiber density on the filter. E (fibers/mm^a); by dividing the total fiber count, F; minus the mean field blank count, B, by the number of fields, h; and the field area. A, (0.00785 mm^a for a properly calibrated Walton-Beckett graticule):

$$E = \frac{(F/n_c - (B/n_b))}{A_c}$$
 fibers/mm²

where:

n,-number of fields in submission sample

n. enumber of fields in blank sample

SKC Guide to NIOSH/OSHA Air Sampling Standards

			•——	A P	L I	N G				
homissi Massrd	Agency	Ref		Yol. (Mer)	Rate (mirmin) g: TWA Calling	Three TWA Colling (hre) (min)	Analytical Method	: SKC Collecting Equip		d Page Number
Numinum, Akyls	OSHA	IMISA100	2 mg/m³	960	2000	8	AAS	FLT 225-8-01	31	HLD 225-3
Numinum & Compounds (as Al)	NIOSH	7013	· - · · · · · · · · · · · · · · · · · ·	360	1000	: 6	AAS-F	FLT 225-5 >	31	HLD 225-3
Juminum, Metal & Oxide	OSHA	IMISA100	10 mg/m²	960	2000	8	AAŞ	FLT 225-8-01	31	HLD 225-3
Numinum Oxide	OSHA	IMIS0160	10 mg/m³	960	2000	8 .	AAS	FLT 225-8-01	31	HLD 225-3
luminum, Pyro Powders	OSHA	IMISA100	5 mg/m³	960	2000	8	AAS	FLT 225-8-01	31	HLD 225-3
luminum, Soluble Salts	OSHA	IMISA100	2 mg/m³	960	2000	8	AAS	FLT 225-8-01	31	HLD 225-3
luminum, Welding Furnes	OSHA	IMISA100	5 mg/m³	960	2000	8	AAS	FLT 225-8-01	31	HLD 225-3
mines, Aliphatic	NIOSH	2010	vanes	20	40	8	GC-FID	ST 226-10	7	
mines, Aromatic	NIOSH	2002	vanes	20	40	8	GC-FID	ST 226-10	. 7	
-Amino Acetanilide	OSHA	IMIS0161			· · · · · · · · · · · · · · · · · · ·		NVM			
-Amino Azobenzene	OSHA	IMISA508	<u>. </u>				NVM			
	NIOSH	4(269)		48	200	4	GC	FLT 225-16	31 7	HLD 225-32
-Amino Diphenyl	OSHA	IMIS0162		50	1000	: 50mm		IMP 225-36-1	29	IT 225-22
	NIOSH	2007		10	20	8		ST 226-10-04	7	11 22522
	NIOSH	5022	 -	960	2000	' 8	IC-AAS	FLT 225-17-01	31	HLD 225-3
	OSHA	IMIS0164			2000		NVM	FC1 223-17-01	3,	TILD EEGS
	NIOSH	4(S158)	0.5	12	100	2	GC	ST 226-35-02		
-Amino Pyndine	OSHA	IMIS0165	0.5	10						
-Amino Pyndine	OSHA	IMISO165	0.5	- '0	20(50)	8(3.3)		ST 226-35 (2)	7	
-Amino-1-Propanol		IMISA608					NVM	<u> </u>		
-Amino-2-Propanol	OSHA			242		<u> </u>	NVM			17 000 00
	NIOSH	3509		240	1000	4		IMP 225-36-1	29	IT 225-22
	NIOSH	3509		240	1000	: 4	I.IC	IMP 225-361	29	IT 225-22
	OSHA	IMISA176	0.2 mg/m³	45 5 5			NVM			
mmonia	· ·	18	ļ	18 2.5			CLR	ST 226-61	7	
	NIOSH	1(205)	50/5min		1000	15min	CLR	IMP 225-36-1	29	IT 225-22
mmonia	NIOSH	5(S347)	50/5mm	30	200	8	SPI ELEC	ST 226-10-06	7	FLT 225-5
				<u> </u>		<u> </u>		HLD 225-2	31	SCN 225-26
mmonia .	NIOSH	6701	50/5min				IC	BDG/C 540-02	44	
mmonia	OSHA	ID 188	35 (STEL)	1.5	100	15min	IC	ST PENDING		
mmonium Chlonde	OSHA	ID 188	10 mg/m³*	24	100	4	IC	ST PENDING		
mmonium Hydroxide (see Ammonia)							1			
mmonium Nitrate	OSHA	IMISA613					NVM		-	
mmonium Sulfamate	NIOSH	5(\$348)	15 mg/m³	90	1500	1	IC	FLT 225-5	31	HLD 225-3
mmonium Sulfamate (Respirable Dust)	OSHA	IMIS0185	5 mg/m³	912	1900	8	GR	FLT 225-8-01 F/HLD 225-1	31 33	HLD 225-3 CYC 225-01-0
mmonium Sulfamate (Total Dust)	OSHA	IMIS0185	10 mg/m ³	720	1500	8	GR	FLT 225-8-01	31	HLD 225-3
-& secArnyl Acetate	NIOSH	1450		10	20(50)	8(3.3)	GC-FID	ST 226-01	7	
-Amyl Acetate	OSHA	07-A	100	10	20(50)	8(3.3)	GC-FID	ST 226-01	7	
c-Amyl Acetate	OSHA	07-B	125	10	20(50)	8(3.3)	GC-FID	ST 226-01	7	
myl Nitrite	OSHA	IMISA607		8	50	2.5	HPLC-UV	ST 226-01	7	
niline	NIOSH	2002		20	40	8	GC-FID	ST 226-10	7	
niline	NIOSH	3(S310)		20	40	8	GC	ST 226-10	7	
niline	OSHA	IMIS0220	2	20	40	. 8	GC-FID	ST 226-10	7	
nisidine	NIOSH	2514		240	1000	. 4		ST 226-30-05	7	
nisidine (o.p.isomers)	NIOSH	5(S163)		240	500	. в	HPLC	ST 226-30-05	7	
	OSHA	IMIS0225	0.5 mg/m³	240		: 4	HPLC	ST 226-30	7	
	NIOSH			600	2000	5	GC-CLR	FLT 225-7	31	FLT 225-1801
nthophyllite Fibers	NIOSH	7400	0.1 f/ml	960	2000	8	PCM	HLD 225-3	31	FL/CL 225-3-1
					·	<u> </u>				FL/CL 225-3-2
	OSHA	58	0.2 mg/m³	960		! 8		FLT 225-7	31	HLD 225-2
	NIOSH	2(S2)		360		4		FLT 225-5	31	HLD 225-3
	OSHA	ID 121	0.5 mg/m³	960	2000	8		FLT 225-5	31	HLD 225-3
itimony & Compounds (as Sb)	OSHA	ID 125	0.5 mg/m³	960	2000	8		FLT 225-5	31	HLD 225-3
	NIOSH	4(261)		45	1500	30mm	AA .	FLT 225-5	31	HLD 225-3
tineoplastic Drugs	OSHA	IMISA617					NVM			
tu (Alphanaphthyl Thiourea)	NIOSH	5(S276)		480	2000	4	HPLC	FLT 225-17-01	31	HLD 225-2
itu (Alphanaphthyl Thiourea)	OSHA	IMIS0235	0.3 mg/m³	480	2000	8	HPLC-UV	FLT 225-17-01	31	HLD 225-2
	NIOSH	7903	2	48		. 4		ST 226-10-03	7	
	OSHA	IMIS0240					NVM			
	NIOSH	7300	2 ug/m³ i	960	2000	8		FLT 225-5	31	HLD 225-3
senic	OSHA	ID 105	.01 mg/m³	960	2000	8		FLT 225-5	31	HLD 225-2
		7900	2 ug/m³/15	30	2000	15	•		31	HLD 225-3
senic	NIOSH	/300		480	1000	8	AAS-GF. W		31	HLD 225-3
senic senic & Compounds (as As)	NIOSH		.01 mg/m³					SM TB 225-24	34	
senic senic & Compounds (as As)		IMIS0260	.01 mg/m²					UM 10 444 47F	~~	
senic & Compounds (as As) senic & Compounds (as As)	NIOSH OSHA	IMIS0260	.01 mg/m³		2000	. A			31	HLD 225.2
senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As)	NIOSH OSHA NIOSH	IMIS0260 5022		96	2000	8	IC-AAS	FLT 225-17-01	31	HLD 225-2
senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As)	NIOSH OSHA NIOSH NIOSH	1MIS0260 5022 7901	.01 mg/m² 2 ug/m²/15	96 30	2000	15	IC-AAS AAS-GF	FLT 225-17-01	31	HLD 225-3
senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As) senic Organo senic Organo senic Trioxide (as As) senicals Particulates	NIOSH OSHA NIOSH NIOSH NIOSH	5022 7901 6(320)		96 30 300	2000 1500	3.3	IC-AAS AAS-GF IC-AAS	FLT 225-17-01 FLT 225-5 FLT 225-17-01	31 31	
senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As) senic Organo senic Trioxide (as As) senicals Particulates sine	NIOSH NIOSH NIOSH NIOSH NIOSH	5022 7901 6(320) 6001	2 ug/m³/15	96 30 300 10	2000 : 1500 20	3.3 8	IC-AAS AAS-GF IC-AAS AA-GF	FLT 225-17-01 FLT 225-5 FLT 225-17-01 ST 226-01	31 31 7	HLD 225-3
senic senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As) senic Organo senic Trioxide (as As) senicats Particulates sine	NIOSH OSHA NIOSH NIOSH NIOSH	5022 7901 6(320)		96 30 300	2000 1500	3.3	IC-AAS AAS-GF IC-AAS	FLT 225-17-01 FLT 225-5 FLT 225-17-01	31 31	HLD 225-3
senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As) senic Corgano senic Trioxide (as As) senicas Particulates sine sine sine	NIOSH OSHA NIOSH NIOSH NIOSH OSHA	5022 7901 6(320) 6001 IMIS0270	2 ug/m³/15 0.05	96 30 300 10 30	2000 : 1500 :20 :200	3.3 8 2.5	IC-AAS AAS-GF IC-AAS AA-GF AAS/GF	FLT 225-17-01 FLT 225-5 FLT 225-17-01 ST 226-01	31 31 7	HLD 225-3 HLD 225-3
senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As) senic Trioxide (as As) senicate Particulates sine sine sine sine sine sine sine si	NIOSH OSHA NIOSH NIOSH NIOSH OSHA	5022 7901 6(320) 6001 IMIS0270	2 ug/m³/15 0.05 0.2 fbr/cc	96 30 300 10 30	2000 : 1500 : 20 : 200 : 2000	3.3 8 2.5	IC-AAS AAS-GF IC-AAS AA-GF AAS/GF PCM	FLT 225-17-01 FLT 225-5 FLT 225-17-01 ST 226-01	31 31 7	HLD 225-3 HLD 225-3 FLT 225-3-12
senic & Compounds (as As) senic & Compounds (as As) senic & Compounds (as As) senic Organo senic Trioxide (as As) senicals Particulates sine sine sine sine sina (see Carbaryl)	NIOSH OSHA NIOSH NIOSH NIOSH OSHA	5022 7901 6(320) 6001 IMIS0270	2 ug/m³/15 0.05	96 30 300 10 30	2000 : 1500 :20 :200	3.3 8 2.5	IC-AAS AAS-GF IC-AAS AA-GF AAS/GF	FLT 225-17-01 FLT 225-5 FLT 225-17-01 ST 226-01	31 31 7	HLD 225-3 HLD 225-3

VERS April 27, 1993 NM Asbestos (all forms) DESC Fine, slender, flaxy fibers; resists fire and most solvents. IMIS 9020 CAS 1332-21-4 NIOSH RTECS C16475000 DOT 2212 31: 2590 31 OSHA Cancer & Lung Disease Hazard 29 CFR 1910.1001 . TWA 0.2 F/cc . STEL 1.0 F/cc

. ACTION LEVEL 0.1 F/cc

TLV See Dusts and Appendix Ala (Human carcinogens)

REL 0.1 fiber/cc per 400 L air sample; Carcinogen

IARC Group 1, carcinogenic to humans

NTP Human Carcinogen

HLTH Cancer (HE1); Asbestosis (HE10)

SYMPT Dyspnea; interstitial fibrosis; restricted pulmonary functioning; finger clubbing; (carcinogenic)

ORG Lungs

SLC1 MEDIA: Mixed Cellulose Ester Filter (MCEF) 0.8 microns (open face)

25 mm cassette with 50 mm conductive cowl

MAX V: 1200 Liters MAX F: 2.5 L/min MIN F: 0.5 L/min (TWA)

MIN V: 48 Liters MAX F: 2.5 L/min MIN F: 1.6 L/min (STEL)

ANL 1: Phase Contrast Microscopy; PCM

. REF: 2 (OSHA ID-160) SAE: 0.25 CLASS: Fully Validated

NOTE: Do not request multiple analytes. Do not overload. If dust

is high, reduce air volume to avoid overloading. A minimum of 2

blanks or 10% are required for every set.

WIPE Do not use Whatman or other paper filters. Bulk preferred.

DIV I

BRANCH MIC